IMPROVE CAPABILITY PROCESS TO OPTIMIZING PRODUCTIVITY: CASE STUDY LINE PROCESS PACKING ASSEMBLY IN ELECTRONIC MANUFACTURING COMPANY

Mohammad Rofiudin¹, Dana Santoso²

¹Master of Industrial Engineering Student, Universitas Mercu Buana Jakarta ²Master of Industrial Engineering Program, Universitas Mercu Buana Jakarta Corresponding author: <u>rofipiko@gmail.com</u>

Abstract

Six sigma is a method for improving processes that focus on reducing process variations using statistical approaches and effective problem solving. The purpose of this method is calculating the impact of six sigma applications to company productivity. Six sigma not only aims to achieve zero defect, with the Six Sigma method optimizing production (Productivity), Six sigma, supporting the proper procedures in line with business goals both system and process. With the DMAIC method, we get as much information as possible and as soon with the smallest sample unit of the experiment. From the results of the paper, Takt Time reduce, $9.2s \rightarrow 8.5s$ proved by DMAIC analysis to get effective and efficient improvement that ultimately can improve the company's efficiency.

Keywords: control, define, improve, measure, optimizing, six sigma.

1 Introduction

The industrial revolution has grown rapidly and has spread around the world (Ashworth, 2014). This has resulted in more competition to ensure the position of market leaders. The company is expected to take advantage of this free competition challenge as a chance to succeed. In many manufacturing companies there is a waste (Mehta, et al., 2012), so the companies must be able to minimize the things that can be threated to survive in today's free competition. Therefore, it is necessary to improve all process paths through the six sigma approach. Six sigma is regarded as a powerful engine for innovation management in this modern era (Belfo, et al., 2015), six sigma is a method for improving processes that focus on reducing process variations using statistical approaches and effective problem solving. The purpose of this research is calculating the impact of six sigma applications to company productivity.

The company that is the object of research in this research is the one of the global companies with the title of "Top 5 largest Exporter in Indonesia" (Kemenperin.go.id), which is engaged in manufacturing producing electronic equipment with a production scale of 1.5-2.0 million products per year, with a total employee of 1000-1500 employees. In order to meet customer satisfaction, the company places a customer's position as a King, in which the company must maintain the credibility of QDC (Quality, Delivery, and Cost) to promote increased company competitive advantage (Gosh, et al., 2016).

2 Literature Review

In order to increase productivity, the company must have good planning (Jonsson et al., 2016), the company have to set production targets and estimate the resources needed to achieve those objectives, efficient and on time (Kim et al., 2012). Planning production can predict every step in the production process (Sivakumar et al., 2012), as well as to predict the possible problems of production processes to eliminate the cause of waste. One of the most important requirements to gain trust from customers is to deliver products/services within an agreed timeframe (Boon-itt, 2011), since delivery must be one of the priorities for every business. For the theory is quite easy, namely; orders must be delivered accurately and arrive on time. However, many companies have difficulty in overcoming the problems that exist at their upstream level (Thunberg, et al., 2017). OTD are performance indicators that have a greater impact on customers (Van Looy, 2016). Problems that often occur with OTD often affect many areas of the company's supply chain (Danese et al,

2012). Some examples include delays in production due to material shortages, shipping costs accelerated so production costs will be increased.

Each company has different ways of measuring OTD (Ting, 2010). Basically OTD is the calculation of the amount of shipment that is sent on time to the customer in accordance with the number of orders. To improve the service of OTD (Wang, 2015), the company has several alternative strategies (Bodislav, 2014), among others; 1. Chase Strategy, 2. Level strategy.

The ability of production lines to produce products/services within a certain time, to keep the OTD well, the company strives to increase its production capacity (Tamas, et al., 2017), by means of; speed up production time or takt time reduce, as well as new machine investment with better capability. Strategies aimed at making production lines flexible enough to absorb external and internal deviations (Modrak, et al., 2017). There are two types of line of balancing, which are; 1. Static balance, 2. Dynamic balance.

Six Sigma's practical thinking method that refers to results, both practitioners and management (Bititci, et al., 2011). Six Sigma Management philosophies can be explained; Six Sigma is a smart and efficient way of working (Barjaktarovic, et al., 2011). Six Sigma is top down Management and focuses on the real situation in the field (Schiele, et al., 2011). Six Sigma is a language/easy communication for the organization (Yazdani, et al., 2015). The Six Sigma method is the basis for clear understanding and precise action under real circumstances (Yu, et al., 2010).

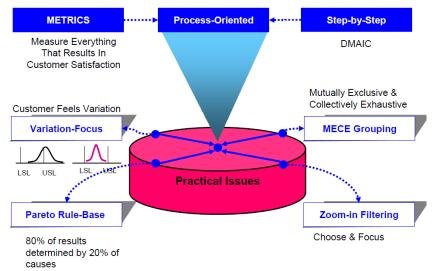


Figure 1 Basic Six Sigma Principle Method.

Source: Training module "Global Standard Six Sigma Training 2005" electronic manufacturing company

The process is a set of actions or operations that transfer materials or resources to products and services based on customer needs. Examples of MECE mergers;

- SWOT: Strong, Weak, Opportunity, Threats
- 4C: Customers, Participants, Companies, Channels
- 4P: Products, Prices, Places, Promotions.

There are two ways to calculate sigma level based on the data used, among others;

- Continues data \rightarrow measured / distributed data, length, weight, time
- Attribute data \rightarrow calculated data / proportion, number of defects, number of products.

In general, σ (Sigma) -level is calculated using attribute data, that is, at the statistical measurement stage for process acquisition, the defect rate decreases when the level sigma increases (Jose, et al., 2017). But the sigma level can also be calculated using measured data (Continues data), namely by calculating the Z-Bench (ST-LT) value, Z-shift (LG Electronics, 2005).

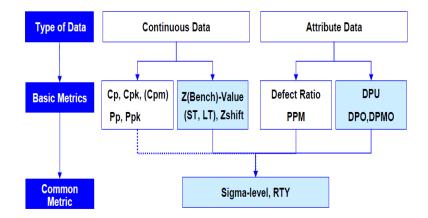


Figure 2 Calculation of sigma level based on data used.

Source: "Global Standard Six Sigma Training 2005" training module for electronic manufacturing companies

3 Method

Six Sigma supports the proper procedures in line with the business objectives of both systems and processes. DMAIC can be explained through the following drawings/schemes;

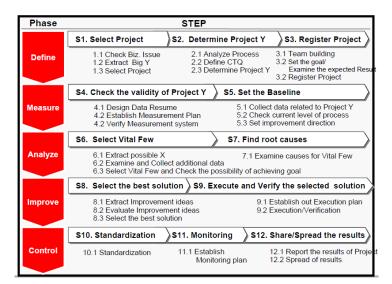


Figure 3 Six Sigma Project Direction Plan.

Source: Training module "Global Standard Six Sigma Training 2005" electronic manufacturing company

From the above scheme, we can simplify DMAIC steps or steps as follows;

✓ Define

- Choose an important project theme in the Customer's side and also have a huge business impact
- Clarify the achievements and resources of the project successfully completed
- ✓ Measure
 - Check the validity of the measurements for Selected Y Project, Set the Baseline after measuring the current level of project Y, and then determine the objective and direction of the improvement.

✓ Analysis

- Extract the possible X factor for the Project Y repair from the Investigation Stage, then select the Vital view factor based on factor X. Find the main cause of each of several important factors.

✓ Improve

- Lower design improvements to processes based on several important factors and / or roots are selected from the Analysis phase, and then choose the best solution between them.
- The selected repair solution should be performed in practice.


✓ Controls

- Prepare a standardized management plan to continue to maintain the best results from the Upgrade Stage. : Create a basis for sharing results and / or certified methods to other areas of the organization
- Set up a standard management plan to keep the best results from the improvement phase.
- Create a base for sharing verified results / methods to other areas.

4 Result and Discussion

1. Define

- Background: Production target increases 10% for next year.
- Big Y Extracting;

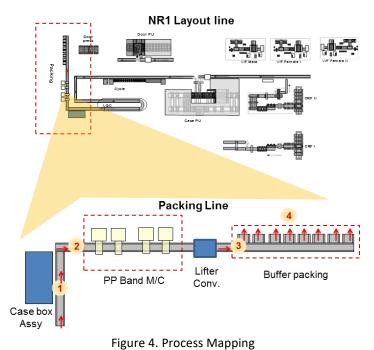

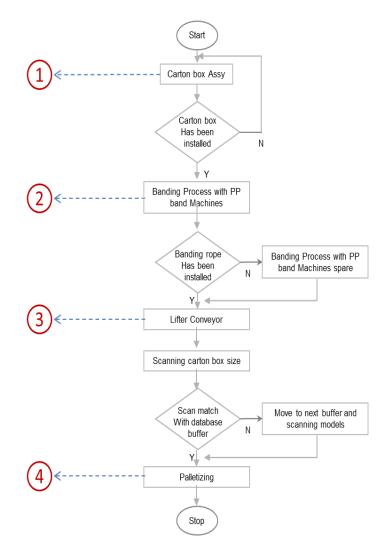


Figure 5 Takt Time Status Packing Line Machine

* Problem Analysis

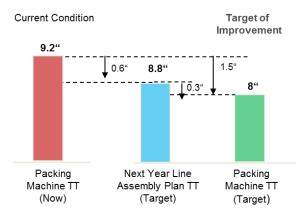


Figure 6 Takt Time Status Packing Line Machine

 Problem Statement: Unbalance takt time packing line between machines and line process assembly.

2. Measure

- Validity Project Y:

Data Resume Measurement Test Visual Test Instrument Data Collection Meth Manual Measurement Plan What Time process When April How Many 60 Measurement Tools Stop watch e characteristic of Y is Takt time Gage R&R is Taken by 3 Operator an 2 times replication. Study Var %Study Var %Tolerance Source Study Var %Tolerance Prit-To-Fart 0.0075952 Operator Machine 0.0074598 0.044759 Part-To-Fart 0.90653 Operator Machine 0.0074598 0.044759 Part-To-Fart 0.996863 Upontority 0.058884 Machine 0.056 Part-To-Fart 0.9981491 Operator Machine 0.058884 Moco 25 NDC 25		Measure	Takt Time
Measurement Test Test Instrument Data Collection Meth Manual Data Collection Meth Manual Measurement Plan What Time process What Time process What Time process What Time process When April How Many 60 Measurement Tools Stop watch e characteristic of Y is Takt time Stop watch Succe Study Var %Study Var %Tolerance Source Study Var %Study Var %Tolerance Source Studber (SD) (6 * SD) (%SV) (\$V/Toler) % Tolerance < 20% Reproducibility 0.0148859 0.089331 15.17 1.12 % Stid Variance < 20% Reproducibility 0.007722 0.016633 2.82 0.21 0.06 Part-To-Part 0.0986633 0.60118 96.61 7.25 NDC > 5		Type Of Measure	Continue data
Measurement Plan What Time process What Time process What Time process What Time process When April How Many 60 Measurement Tools Stop watch e characteristic of Y is Takt time Stop watch Gage R&R is Taken by 3 Operator an 2 times replication. Study Var %Study Var %Tolerance Source Study Var %Study Var %Tolerance Source Study Var %Study Var %Tolerance Papeatability 0.0148885 0.089331 15.17 1.27.4 1.27.4 Part-To-Part 0.007562 0.021722 Operator Machine 0.0074598 0.044759 Part-To-Part 0.098683 0.661 Part-To-Part 0.098683 9.8611 Outed Variation 0.098149 0.058894 Part-To-Part 0.988683 9.8611 Outed Sci Josef Jo		Measurement Test	
Measurement Plan Vvho Bambang Vvho Bambang Vvho April How Many 60 Measurement Tools Stop watch e characteristic of Y is Takt time Stop watch Gage R&R is Taken by 3 Operator an 2 times replication. Study Var %Study Var %Tolerance Source Studbev (SD) (6* SD) (%W) (SVToler) Repeatability 0.016633 2.82 0.21 Operator 0.0027722 0.016633 2.82 0.21 operator/Machine 0.007722 0.016633 2.82 0.21 operator/Machine 0.007722 0.016633 2.82 0.21 operator/Machine 0.007722 0.016633 2.82 0.21 operator/Machine 0.00863 0.660 0.560 Part-To-Part Total Variation 0.0981491 0.588894 100.00 7.36		Data Collection Meth	Manual
Plan vvho Bambang Vvhen April How Many 60 Measurement Tools Stop watch e characteristic of Y is Takt time Gage R&R is Taken by 3 Operator an 2 times replication. Surce StdDev (SD) (6* SD) Study Var %Study Var %Tolerance Source StdDev (SD) (6* SD) Repetability 0.014885 0.0089331 15.17 Fart-To-Fart 0.006682 operator*Machine 0.0074598 0.044759 0.0086683 0.580118 98.511 0.56 Part-To-Fart 0.0986683 0.0981491 0.056 NDC > 5			Time process
How Many 60 Measurement Tools Stop watch e characteristic of Y is Takt time Stop watch Gage R&R is Taken by 3 Operator an 2 times replication. Study Var % Study Var % Tolerance Source StdDev (SD) (6 * SD) (% SV) (SV/Toler) % Tolerance < 20%			Bambang
Measurement Tools Stop watch e characteristic of Y is Takt time Study Var % Study Var % Tolerance Gage R&R is Taken by 3 Operator an 2 times replication. Study Var % Study Var % Tolerance Source Study Var % Study Var % Tolerance Source Study Var % Study Var % Tolerance Repeatability 0.014885 0.016682 0.47749 Reproducibility 0.0027722 0.0027722 0.016633 2.82 0.0027722 0.016633 2.82 0.9874.07 7.26 7.25 Total Variation 0.986683 0.580118 96.512 0.588894 100.00 0.014 0.588894 100.00		When	April
e characteristic of Y is Takt time Gage R&R is Taken by 3 Operator an 2 times replication. Study Var %Study Var %Tolerance Source StdDev (SD) (6 * SD) (%SV) (SV/Toler) % Tolerance < 20% Total Gage R& 0.0168819 0.01229 17.20% 1.27% * Std Variance < 20% Repeatability 0.0079582 0.047749 8.11 0.60 operator 0.0027722 0.016633 2.82 0.21 operator Machine 0.0074598 0.044759 7.60 0.56 Part-To-Part 0.0968683 0.580118 98.51 7.25 Total Variation 0.0981491 0.588894 100.00 7.36 NDC > 5		How Many	60
Gage R&R is Taken by 3 Operator an 2 times replication. Study Var % Study Var %Tolerance Source % Study Var %Tolerance Source 150 av (% SV) (SV/Toler) % Tolerance < 20%	Measurement Tools	Stop	watch
	Study Va Source StdDev (Total Gage R&R 0.0168: Repeatability 0.0148: Reproducibility 0.0079; operator 0.0027; operator 0.0027; operator Machine 0.0074 Part-To-Part 0.09661	r %Study Var %Tolerance SD) (6 * SD) (%SV) (SV/Toler) 219 0.101292 (7.20*, 127* 865 0.089331 15.17 - 1.12 82 0.047749 8.11 0.60 722 0.01663 2.82 0.21 598 0.044759 7.60 0.56 163 0.580118 98.51 7.25	% Std Variance < 20%

Figure 7 Gage R&R Test

From gage R&R analysis result above, we may conclude that gage R&R analysis is acceptable.

3. Analysis

- Vital Few Defining

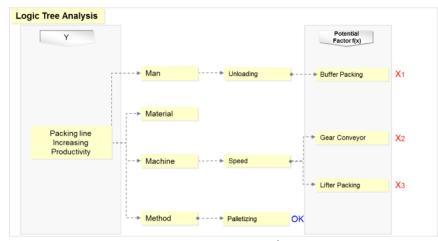


Figure 8. Logic Tree Analysis

- Vital Factor Selecting (Hypothesis)

The logical analysis is generated through brainstorming from operators, technicians and personnel maintenance, to obtain vital factor, among others; packing buffer, gear conveyor speed, lifter packing.

- Vital Factor Defining

The few key factors that have been gained through the brainstorming above, we will test each factor, to prove whether it is some of the key factors or not.

- Vital Factor Selecting (After Test)

From the test results, we can conclude Conveyor is an important Vital Factor that needs to be improved to improve the sigma level.

4. IMPROVEMENT

- Solution : Increase speed Conveyor by changing Conveyor gear (21 pin \rightarrow 14 pin).

- Verification & Result

After we do improvement, we will do the testing of capability analysis to know result after improvement. We can get significant decrease of takt time 9.2s \rightarrow 8.5s.

5. CONTROL

- Standardize

Increase speed Conveyor by changing Conveyor gear (21 pin \rightarrow 14 pin).

Monitoring

Collect some takt time data's after improvement and making control chart to monitoring the result of improvement that is stable or not.

5 Conclusion

The research result got the decreasing takt time 9.2sec \rightarrow 8.5 sec, proved by DMAIC method obtained by effective and efficient improvement that impact to efficiency of the company.

Refference

- Ashworth, W. J. (2014). The British industrial revolution and the ideological revolution: Science, Neoliberalism and History. *History of Science*, 52(2), 178-199.
- Barjaktarovic, L., & Jecmenica, D. (2011). Six Sigma Concept. Acta Technica Corviniensis-Bulletin of Engineering, 4(4), 103.
- Belfo, F., Trigo, A., & Estébanez, R. P. (2015). Impact of ICT Innovative Momentum on Real-Time Accounting. Business Systems Research Journal, 6(2), 1-17.
- Bititci, U. S., Ackermann, F., Ates, A., Davies, J., Garengo, P., Gibb, S., ... & Shafti, F. (2011). Managerial processes: business process that sustain performance. *International Journal of Operations & Production Management*, 31(8), 851-891.
- Bodislav, D. A., Bran, F., & Iovitu, M. (2014). Managing Corporate Strategy from the Expansion Perspective 1. *Revista de Management Comparat International*, *15*(5), 566.
- Boon-Itt, S., & Yew Wong, C. (2011). The moderating effects of technological and demand uncertainties on the relationship between supply chain integration and customer delivery performance. *International Journal of Physical Distribution & Logistics Management*, *41*(3), 253-276.
- Danese, P., Romano, P., & Bortolotti, T. (2012). JIT production, JIT supply and performance: investigating the moderating effects. *Industrial Management & Data Systems*, 112(3), 441-465.
- Jonsson, P., & Mattsson, S. A. (2016). Advanced material planning performance: a contextual examination and research agenda. *International Journal of Physical Distribution & Logistics Management*, 46(9), 836-858.
- Kemenperin_RI (2017). Ekspor Elektronik dan Telematika Bisa Tembus US\$ 12M. Retreived from http://www.kemenperin.go.id/artikel/5284/Ekspor-Elektronik-dan-Telematika-Bisa-US\$-12-M
- Kim, S., & Yoo, S. (2012). The combined manpower planning and preventive maintenance strategies by aggregate planning for the service division of vending machines. *Journal of the Operational Research Society*, 63(8), 1034-1050.
- LG Electronics Inc, LG Global Standard Six Sigma Training Guide Book, Seoul, 2005.
- Mehta, R. K., Mehta, D., & Mehta, N. K. (2012). Lean manufacturing practices: problems and prospects. *Annals of the Faculty of Engineering Hunedoara*, *10*(3), 119.
- Modrak, V., & Soltysova, Z. (2017). Novel complexity indicator of manufacturing process chains and its relations to indirect complexity indicators. *Complexity*, 2017.

- Purba, H. H. (2016). Reducing the operational stop time of Hauller Komatsu Hd465-7 by using the Six Sigma's approach in Pt X. *ComTech: Computer, Mathematics and Engineering Applications*, 7(2).
- Schiele, J. J., & McCue, C. P. (2011). Lean thinking and its implications for public procurement: moving forward with assessment and implementation. *Journal of Public Procurement*, *11*(2), 206-239.
- Sivakumar, A., & Saravanan, K. (2012). TOOLS AND MODELS USED FOR PRODUCTIVITY IMPROVEMENT IN MANUFACTURING, CHEMICAL AND CHEMICAL ALLIED INDUSTRIES: A LITERATURE REVIEW. *International Journal of Management Research and Reviews*, *2*(2), 293.
- Tamas, P. (2017). Decision Support Simulation Method for Process Improvement of Intermittent Production Systems. *Applied Sciences*, 7(9), 950.
- Thunberg, M., Rudberg, M., & Karrbom Gustavsson, T. (2017). Categorising on-site problems: A supply chain management perspective on construction projects. *Construction Innovation*, 17(1), 90-111.
- Van Looy, A., & Shafagatova, A. (2016). Business process performance measurement: a structured literature review of indicators, measures and metrics. *SpringerPlus*, 5(1), 1797.
- Wang, C. T., & Su, S. J. (2015). Strategic capacity planning for light emitting diode (LED) supply chains across Taiwan and China. *Journal of the Operational Research Society*, *66*(12), 1989-2003.
- Yazdani, A., Neumann, W. P., Imbeau, D., Bigelow, P., Pagell, M., Theberge, N., ... & Wells, R. (2015). How compatible are participatory ergonomics programs with occupational health and safety management systems?. Scandinavian journal of work, environment & health, 111-123.
- Yu, J., & Zaheer, S. (2010). Building a process model of local adaptation of practices: A study of Six Sigma implementation in Korean and US firms. *Journal of International Business Studies*, *41*(3), 475-499.